



SOLDADURAS CABLE A CABLE

TIPO SS: EMPALME HORIZONTAL DE CABLES

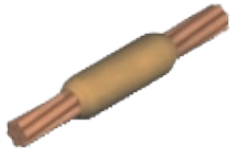

Conexiones a tope cables a cables				
Cable en mm2		Molde	Carga N°	Manija
10		SSC - 10	25	L - 160
16		SSC - 16	25	L - 160
25		SSC - 25	32	L - 160
35		SSC - 35	32	L - 160
50		SSC - 50	45	L - 160
70		SSC - 70	65	L - 160
95		SSC - 95	90	L - 160
120		SSC - 120	115	L - 160

TIPO TA: TE DE CABLE PASANTE Y DERIVACIÓN



Conexiones en TE cables a cables				
Cable en mm2		Molde	Carga N°	Manija
Pasante	Derivación			
16	16	TAC - 1616	32	L - 160
25	25	TAC - 2525	32	L - 160
35	35	TAC - 3535	45	L - 160
	25	TAC - 3525	45	L - 160
	16	TAC - 3516	45	L - 160
50	50	TAC - 5050	90	L - 160
	35	TAC - 5035	45	L - 160
	25	TAC - 5025	45	L - 160
	16	TAC - 5016	45	L - 160
70	70	TAC - 7070	90	L - 160
	50	TAC - 7050	90	L - 160
	35	TAC - 7035	45	L - 160
	25	TAC - 7025	45	L - 160
	16	TAC - 7016	45	L - 160
95	95	TAC - 9595	115	L - 160
	70	TAC - 9570	90	L - 160
	50	TAC - 9550	90	L - 160
	35	TAC - 9535	90	L - 160
120	120	TAC - 120120	150	L - 160
	95	TAC - 12095	150	L - 160
	70	TAC - 12070	90	L - 160
	50	TAC - 12050	90	L - 160
	35	TAC - 12035	90	L - 160


TIPO XA: CABLES EN CRUZ CORTADOS (UNO O AMBOS)

Conexiones en cruz cables a cables cortando uno				
Cable en mm2		Molde	Carga N°	Manija
Pasante	Derivación			
16	16	X AC - 1616	45	L - 160
25	25	XAC - 2525	45	L - 160
35	35	X AC - 3535	65	L - 160
	25	X AC - 3525	65	L - 160
	16	X AC - 3516	65	L - 160
50	50	X AC - 5050	90	L - 160
	35	X AC - 5035	90	L - 160
	25	X AC - 5025	90	L - 160
	16	X AC - 5016	90	L - 160
70	70	XAC - 7070	115	L - 160
	50	X AC - 7050	115	L - 160
	35	X AC - 7035	115	L - 160
	25	X AC - 7025	115	L - 160
95	95	X AC - 9595	200	L - 160
	70	X AC - 9570	150	L - 160
	50	X AC - 9550	150	L - 160
	35	XAC - 9535	115	L - 160
120	120	XAC - 120120	200	L - 160
	95	XAC - 12095	200	L - 160
	70	XAC - 12070	150	L - 160
	50	XAC - 12050	150	L - 160
	35	XAC - 12035	115	L - 160




TIPO XB: CABLES EN CRUZ PASANTES SIN CORTAR

Cables en cruz pasantes sin cortar				
Cable en mm2		Molde	Carga N°	Manija
Pasante	Derivación			
16	16	XBC - 1616	65	L - 160
25	25	XBC - 2525	65	L - 160
35	35	XBC - 3535	90	L - 160
	25	XBC - 3525	90	L - 160
	16	XBC - 3516	65	L - 160
50	50	XBM - 5050	150	Armadura M+160
	35	XBM - 5035	115	Armadura M+160
	25	XBM - 5025	115	Armadura M+160
	16	XBM - 5016	115	Armadura M+160
70	70	XBM - 7070	200	Armadura M+160
	50	XBM - 7050	200	Armadura M+160
	35	XBM - 7035	150	Armadura M+160
	25	XBM - 7025	150	Armadura M+160
95	95	XBM - 9595	250	Armadura M+160
	70	XBM - 9570	200	Armadura M+160
	50	XBM - 9550	200	Armadura M+160
	35	XBM - 9535	150	Armadura M+160
120	120	XBM - 120120	2-150	Armadura M+160
	95	XBM - 12095	2-150	Armadura M+160
	70	XBM - 12070	250	Armadura M+160
	50	XBM - 12050	250	Armadura M+160
	35	XBM - 12035	150	Armadura M+160

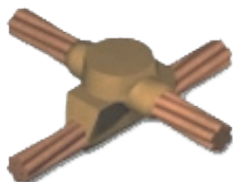

TIPO PT: CABLES PARALELOS PASANTES HORIZONTALES

Conexiones paralela horizontal cable a cable				
Cable en mm2		Molde	Carga N°	Manija
Pasante	Derivación			
16	16	PTC - 1616	32	L - 160
25	25	PTC - 2525	45	L - 160
35	35	PTC - 3535	65	L - 160
	25	PTC - 3525	65	L - 160
	16	PTC - 3516	65	L - 160
50	50	PTC - 5050	90	L - 160
	35	PTC - 5035	65	L - 160
	25	PTC - 5025	65	L - 160
	16	PTC - 5016	65	L - 160
70	70	PTC - 7070	115	L - 160
	50	PTC - 7050	115	L - 160
	35	PTC - 7035	90	L - 160
	25	PTC - 7025	90	L - 160
	16	PTC - 7016	90	L - 160
95	95	PTC - 9595	200	L - 160
	70	PTC - 9570	150	L - 160
	50	PTC - 9550	150	L - 160
	35	PTC - 9535	150	L - 160
	25	PTC - 9525	150	L - 160
	16	PTC - 9516	150	L - 160
120	120	PTC - 120120	250	L - 160
	95	PTC - 12095	200	L - 160
	70	PTC - 12070	150	L - 160
	50	PTC - 12050	150	L - 160
	35	PTC - 12035	150	L - 160
	25	PTC - 12025	150	L - 160

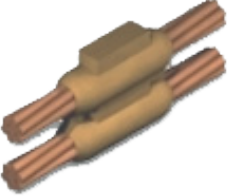

TIPO PC: DERIVACIÓN PARALELA DE CABLES HORIZONTALES

Derivación paralela cables horizontales				
Cable en mm2		Molde	Carga N°	Manija
Pasante	Derivación			
16	16	PCC - 1616	32	L - 160
25	25	PCC - 2525	45	L - 160
	16	PCC - 2516	45	L - 160
35	35	PCC - 3535	65	L - 160
	25	PCC - 3525	65	L - 160
	16	PCC - 3516	45	L - 160
50	35	PCC - 5035	65	L - 160
	25	PCC - 5025	65	L - 160
	16	PCC - 5016	65	L - 160
70	35	PCC - 7035	90	L - 160
	25	PCC - 7025	90	L - 160
	16	PCC - 7016	65	L - 160
95	35	PCC - 9535	115	L - 160
	25	PCC - 9525	115	L - 160
	16	PCC - 9516	90	L - 160

